

**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 1: TF-4 trench on RAD II



Photograph 2: VER piping in TF-3 trench on RAD II



**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 3: Construction of well vault pad



Photograph 4: Compacting DGA on RAD II

**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 5: New asphalt on RAD II



Photograph 6: Footings for equipment trailers



**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 7: Concrete pad for storage tanks



Photograph 8: Equipment trailers

**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 9: Storage tanks



Photograph 10: Security fence around treatment area



**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 11: Trenching operations on RAD I



Photograph 12: Excavating trench on RAD I

**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 13: Trench restoration on RAD I



Photograph 14: Installation of force main sewer discharge pipe



**Review Avenue Development Sites I & II**  
37-30 & 37-80 Review Avenue  
Long Island City, New York 11101  
Photographic Log for Remedial Action



Photograph 15: Construction of recovery well piping



Photograph 16: Monitoring well installation