

Project: Spectrum Finishing - Remedial Action  
 Contractor: EnviroTrac Environmental Services  
 CDM Job No: D-006956 Site No. 1-52-029  
 CDM Project Manager: John Blaum

CDM  
 100 Crossways Park West  
 Woodbury, NY 11797  
 Telephone: 516.496.8400  
 Fax: 516.496.8864

### DAILY REPORT

Day: 

S	M	T	W	TH	F	S
---	---	---	---	----	---	---

  
 Date: 22-Apr-09  
 REPORT No. 127  
 PAGE No. 1

<b>WEATHER</b>	Clear	Partly Cloudy	Overcast	Rain	Snow
<b>TEMP L/H</b>		48/54			
<b>HUMIDITY</b>	Dry	Moderate	High		
<b>WIND</b>	Calm	Light	Moderate	High	
<b>WIND DIR</b>	N	E	S	W	
	NE	SE	SW	NW	

PREPARED BY: F.Robinson TITLE: Inspector

#### **AVERAGE FIELD FORCE**

Name of Contractor	Title	Hours Worked	Remarks
EnviroTrac	Construction Manager	1x8 hrs	M.Rose
EnviroTrac	Operator	2x8 hrs	B.Gimbel, J. Byrnes
EnviroTrac	Technician	2x8 hrs	R.Maletta, K.Davies
Soil Mechanics	Technician	1x4 hrs	J.Hill

#### **EQUIPMENT AT THE SITE**

I = Idle      W = Working

20" Storage Container - W	
Case CX130 Excavator - W	
Case 621D Front End Loader - W	
Daewoo 450 skidder - W	
Benford TV1200 Roller Vibrator - W	

#### **HEALTH AND SAFETY**

Name	Time (From - To)	Task/Level of PPE
All workers onsite were in level D-PPE		

#### **CONSTRUCTION ACTIVITIES**

<b>Site Representative:</b> Frank Robinson - CDM
<b>Health and Safety Site Officer:</b> N/A
<b>DESCRIPTION OF WORK PERFORMED AND OBSERVED</b>
1-Tailgate H&S meeting performed before the start of the work day.
2-EnviroTrac continues to backfill and compact the excavation, the east alleyway from the utility pole west and the last 10' of the west alleyway.
3-Watral Brothers delivered 2 truck loads (82.64 tons) of backfill material to the site. Total to date = 1,557.95 tons or 3,115,900 pounds.
4-Mr. Jim Hill of Soil Mechanics was on site for compaction testing using a Troxler 3450 Nuclear Density and Moisture Gauge. Measurements were: SE = 96.4%, NE = 98.5%, NW = 96.6%, SW = 98.8%, Center = 99.5% and East Alleyway = 93.6%.

x - Designates report is continued on additional pages

CDM Site Representative: F. Robinson                      Project Manager: John Blaum

**PHOTOGRAPHIC LOG**  
**22-Apr-09**  
**CDM Job No. D-006956**  
**Spectrum Finishing Remedial Action**  
**SITE No. 1-52-029**

<b>PHOTO</b>	<b>DATE</b>	<b>TIME</b>	<b>DESCRIPTION</b>
100_00446.jpg	4/22/2009	AM	Soil Mechanics technician conducting compacting testing in east alleyway
100_00449.jpg	4/22/2009	AM	Backfilling and compacting east alleyway, looking west
100_00450.jpg	4/22/2009	PM	Finished backfilling and compacting last 10' of west alleyway, looking west
100_00451.jpg	4/22/2009	PM	Finished backfilling and compacting the east alleyway, looking east
100_00452.jpg	4/22/2009	PM	Excavation at the end of the day, looking west
100_00453.jpg	4/22/2009	PM	Excavation at the end of the day, looking west

# PHOTOS 4/22/09



100\_00446.jpg - Soil Mechanics technician conducting compaction testing in east alleyway



100\_00449.jpg - Backfilling and compacting east alleyway, looking west





**100\_00450.jpg - Finished backfilling and compacting the last 10' of the west alleyway, looking west.**



**100\_00451.jpg - Finished backfilling and compacting the east alleyway, looking east**




**100\_00452.jpg - Excavation at the end of the day, looking west**



**100\_00453.jpg - Excavation at the end of the day, looking west**



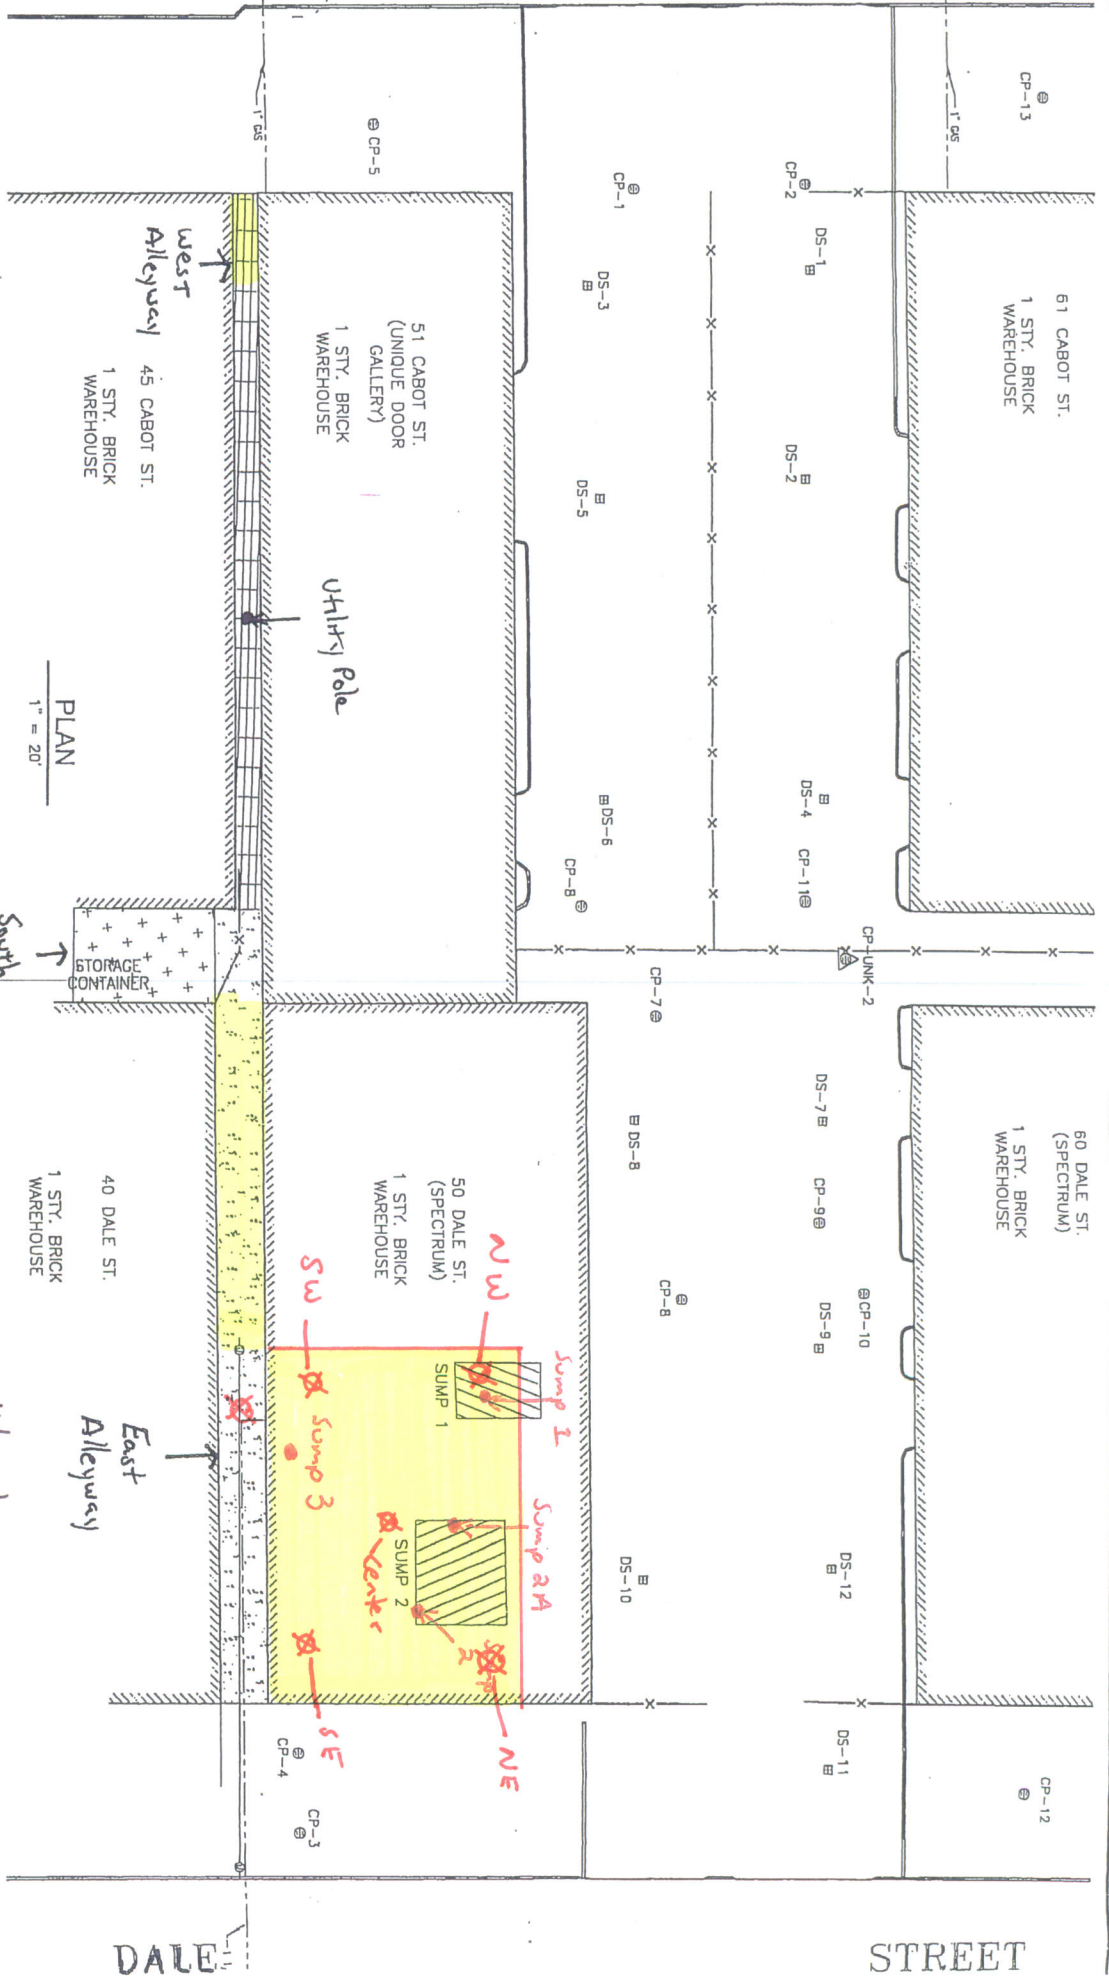

4/22/09

Work Areas

X - Compaction Testing Locations



