

				Page 1	of 1	
Project	NYSDEC Site C224218 - Former Carter Spray Finishing Site	Report No.	4			
Location	65 Eckford Street, Brooklyn, NY	Date	10/28/2021			
Client	65-73 Eckford Realty LLC	Page	1	of	1	
Contractor	Prestige NY	File No.	0202156-000			
Weather	Sunny	Temperature	52° F			
Humidity	73%	Wind Direction	NE			
0755: D. Fu of 1	H&A and contractor on-site. Calibrate and setting up CAMP equipment.					
0800: Measurin	g background CAMP data.					
0815: Contract	or started grading the southern portion of the site via an excavator.					
1215: Disconne	cted power and pipelines of the dewatering system to have the site entrance ready	for truck loading.				
1225: Two dum	p truck arrived (10-wheelers, 30 yard container NY Plate 99966NA, 99965NA fro	m Yoya Services)				
1305: Started lo	pading construction debris to the first truck (Plate: 99966NA).	•				
1310: Loading	completion for the first truck. Started loading vegetation and construction debris t	o the second truck	(Plate: 99965)	NA)		
	completed. Trucks offsite for off-site disposal at Decostole Carting of Brooklyn, N		`			
	ng in the middle of the site for new suction point installation.					
	or grading in the northeastern portion of the site.					
	PID reading near the work area spiked from 4.6 to 12.5 ppm due to exhaust from	excavator, downw	ind CAMP at	3.8 ppm w	ith slight	
	observed. Work halted in area to return air monitoring to within CAMP threshol					
within 15 minu	-	9				
	ne dewatering system.					
	ings return to less than 1 ppm.					
1630: Intrusive work complete, breaking down CAMP equipment. H&A off-site.						
				-		
				-		

NYSDEC Site C224218 - Former Carter Spray Finishing Site 65 Eckford Street, Brooklyn, NY File No. 0202156

Date Photographs Taken: 28 October 2021

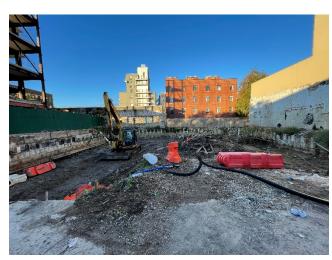


Photo 1: Pre-work view of the site facing west.



Photo 3: Excavation and installing new suction point in the middle of the site.



Photo 2: View of northeast suction point before disconnection.



Photo 4: Post-work view of the site facing northwest.

NYSDEC Site C224218 - Former Carter Spray Finishing Site 65 Eckford Street, Brooklyn, NY 0202156-000 Air Monitoring Log

Date:	10/28/2021
Personnel:	D. Fu
Weather:	Sunny
Humidity:	73%
Temperature:	52° F
Wind Direction:	NE

Particulate Background (μg/m³): 0.005
PID Background (ppm): 0.0

Site Map:





	Dust Particulates (μg/m³)	PID (ppm)		
Time	Downwind	Downwind	Odors (y/n)	Notes/Comments
800	0.006	0.0	N	
815	0.008	0.0	N	
830	0.01	0.3	N	
845	0.009	0.0	N	
900	0.011	0.0	N	
915	0.008	0.0	N	
930	0.009	0.0	N	
945	0.007	0.0	N	
1000	0.008	0.0	N	
1015	0.008	0.0	N	
1030	0.006	0.0	N	
1045	0.007	0.0	N	
1100	0.005	0.0	N	
1115	0.006	0.0	N	
1130	0.006	0.0	N	
1145	0.005	0.0	N	
1200	0.006	0.0	N	
1215	0.006	0.0	N	

NYSDEC Site C224218 - Former Carter Spray Finishing Site 65 Eckford Street, Brooklyn, NY 0202156-000 Air Monitoring Log

	Dust Particulates (μg/m³)	PID (ppm)				
Time	Downwind	Downwind	Odors (y/n)	Notes/Comments		
1230	0.011	0.0	N			
1245	0.009	0.0	N			
1300	0.007	0.0	N			
1315	0.011	0.0	N			
1330	0.01	0.0	N			
1345	0.009	0.0	N			
1400	0.008	0.2	N			
1415	0.01	0.3	N			
1430	0.01	0.4	N			
1445	0.011	0.3	N			
1500	0.012	3.8	Υ	Slight petroleum odor, work stopped		
1515	0.01	1.5	N			
1530	0.011	0.2	N			
1545	0.012	0.1	N			
1600	0.011	1.5	N			
1615	0.013	0.1	N			





Field Notes:

- 1. 95% of site is covered in thick vegetation (i.e. reeds
- Excavation depth site wide is approx. 6' bgs (potential to be deeper as site gently slopes to the west).
 Existing construction ramp located in the central portion of the site and contains gravel.
 Debris and garbage located within the excavation and
- entrance area.
- 5. One permanent groundwater monitoring well observed in the southwestern corner of the site (i.e. in sidewalk within construction fence).

- 1. ALL LOCATIONS ARE APPROXIMATE.
- 2. AERIAL IMAGERY SOURCE: NEARMAP, 12 MARCH 2021







65 ECKFORD STREET BROOKLYN, NEW YORK

SITE PLAN

FIGURE 1 AUGUST 2021