

INSPECTION REPORT

Site Number: V-00334-9/915525

Date: May 25, 2011

Site Name: Grief Bros. Corporation

Location: 2122 Colvin Blvd, Tonawanda

Project Manager: Michael J. Hinton

Project Engineer: Jon Fox ERM

Job Phone: N/A

HEALTH & SAFETY: PPE: Level D

Is the PPE level in conformance with the specifications: N/A

Are atmospheric monitoring results at acceptable levels? N/A

DESCRIPTION OF WORK PERFORMED:

MJH on site at 1005 hrs

Weather – T~65⁰F, mostly sunny, light SE breeze


ERM – Jon Fox, John Kuhn & Jason Reynolds

Pinto – operator, foreman and 2 laborers

Soil excavation essentially complete, 1-2 truck loads remain in SW corner. Portion of approx 4' diameter tank found in central area west of former pipe. Tank carcus removed

PID reading under pipe at south wall ~9800. Requested test pit in short truck bay access road to examine extent of contaminant migration.

PID readings in excavation mostly less than 50. Wall PID readings scanned over 2' length from floor up.

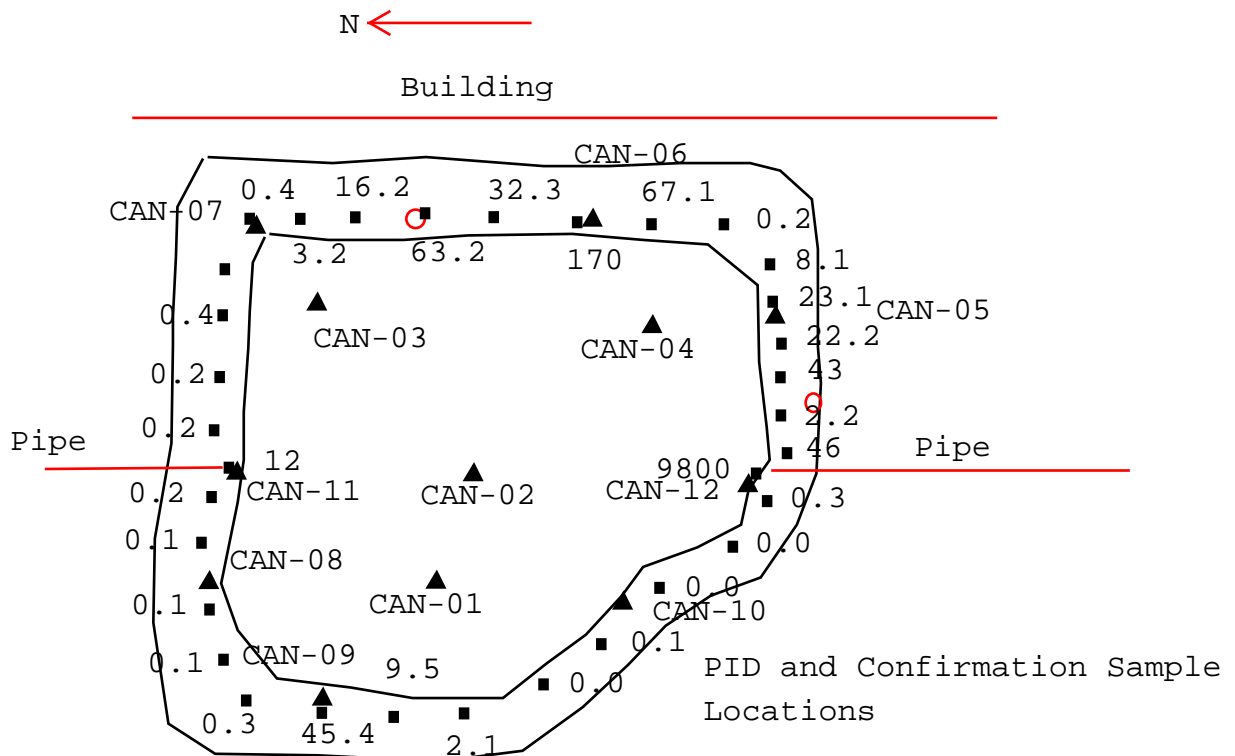

ERM collecting confirmation samples: 2 under pipe, 6 wall and 4 floor samples

Pinto preparing to apply chemical augmentation to exposed soil surfaces in excavation area.

Backfill – sieve analysis <9% passing the 40 screen. Acceptable for use on site without sampling.

Floor samples

CAN-01 (10.5') under old tank collected 5/24/2011
CAN-02 (8.5') under former pipe area 1110 hrs
CAN-03 (8.5') NE Corner 1115 hrs
CAN-04 (9.0') SE corner 1120 hrs

Wall Samples

CON-05 (6.5') S wall 1125 hrs
CON-06 (6.5') E Wall 1130 hrs (duplicate sample collected)
CON-07 (6.5') NE Corner 1135 hrs
CON-08 (5.5') N Wall near West 1145 hrs
CON-09 (5.5-6') west wall 1150 hrs MS/MSD
CON-10 (6-6.5') SW corner 1205 hrs
CON-11 (6.8') Under pipe north side 1210 hrs
CON-12 (6.8') Under pipe south side PID ~950 1215 hrs

Pinto marked out fire line in short truck bay access road for future test pit.

Excavation complete last load out at 1200 hrs

MJH left site at 1220hrs.

Attachments: Photo's

Inspector's Name (Print): Michael J. Hinton

Inspector's Signature:

Date: May 26, 2011



2511-01 ID Locations North wall.jpg



2511-02 PID Locations North Wall.



2511-03 PID Locations East Wall.j



052511-04 SW Corner .jpg



052511-05 Augmentation Tank.jpg



52511-06 Floor Sample CON-03.jp



52511-07 Wall sample CON-05.jp



52511-08 Wall Sample CON-06.jp



511-09 Soil Excavation SW corner



I-10 Excavation Complete SW Cor



52511-11 Complete Excavation.jpg